



INSTALLATION INSTRUCTIONS

Description : **USB SOCKET**


Part Number : 39105-4482*

Applications : UZ125

Installation Time : 0.2 H

Contents


| Ref. | Description | QTY |
|------|---------------|-----|
| ① | USB Socket | 1 |
| ② | QR Code Sheet | 1 |

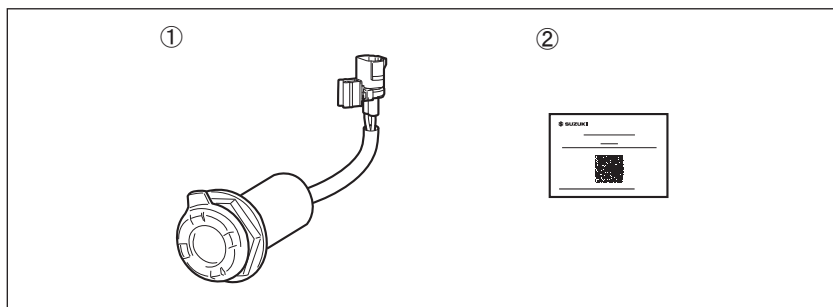

Tools Required

Ref. Description

(1) ⊕ Driver

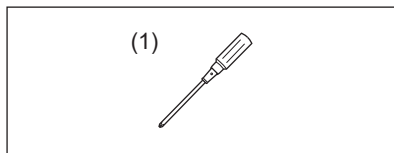

Important**⚠ WARNING / ⚠ CAUTION / ⓘ NOTICE / ⓘ NOTE**

Please read this manual and follow its instructions carefully. To emphasize special information, the symbol **⚠** and the words **WARNING**, **CAUTION**, **NOTICE** and **NOTE** have special meanings. Pay particular attention to messages highlighted by these signal words:

⚠ WARNING

Indicates a potential hazard that could result in death or serious injury.

⚠ CAUTION

Indicates a potential hazard that could result in minor or moderate injury.

NOTICE

Indicates a potential hazard that could result in vehicle or equipment damage. ⇒ ⓘ

NOTE

Indicates special information to make maintenance easier or instructions clearer. ⇒ ⓘ

**Precautions
for
Installation**

1. Check that the kit includes all the parts listed on the first page.
2. Check each part in the kit for scratches or any form of damage.
3. Park the vehicle on a level ground.
4. Remove the ignition key from the switch and store it in a safe place.
5. Disconnect the negative (–) cable from the battery.
6. Protect any items removed or to be installed from scratches by placing them on a soft cloth first before putting them on the ground.
7. Use care not to cause any damage to the body of the vehicle during installation of the accessory.




Be sure to refer to the UZ125 service manual, when removing or installing STD parts.

*** STD parts = Component parts of SUZUKI motorcycle**



Installation Removal of the motorcycle parts


1. Remove the front leg shield (A).

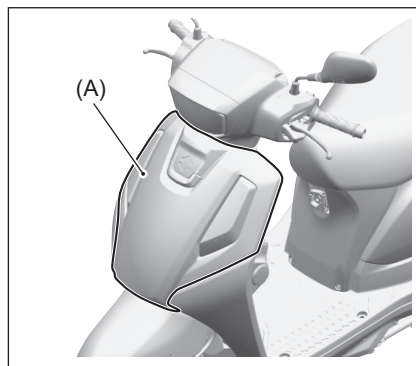

2. Remove the plug cap (B).




Plug cap (B) will not be reused.

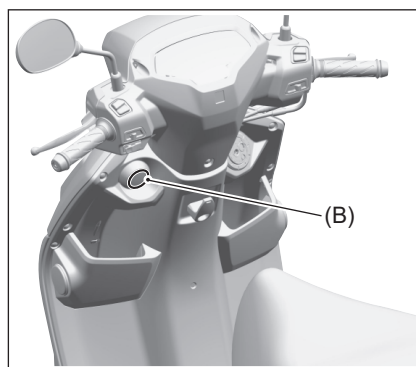

Installation of the USB Socket


1. Remove the holder and cap from the USB Socket ①.

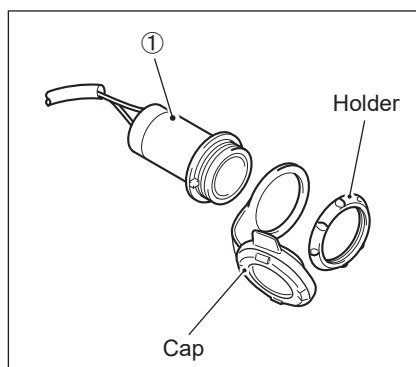


2. Insert the USB Socket ① into hole where the plug cap was removed.



Fit the convex of the USB Socket ① in the notch of the hole.

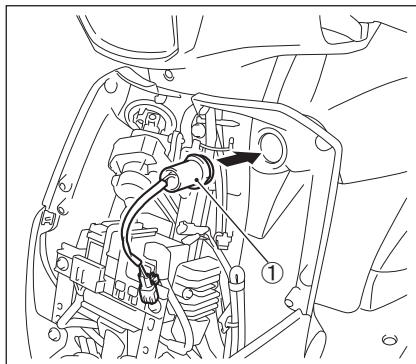


3. Adjust the direction of the cap as shown and fix the USB Socket ① with the holder firmly.

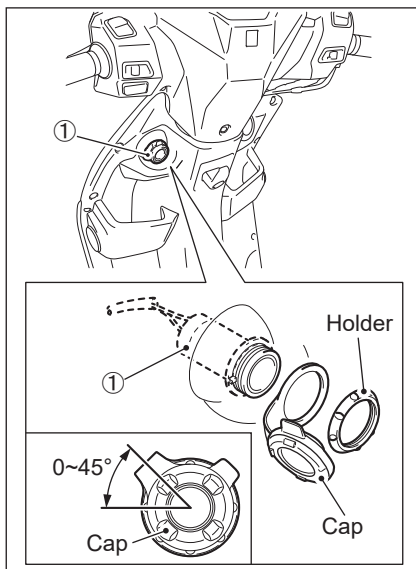


4. Peel the tape (2 places) from the motorcycle harness and remove the cap (C).



Cap (C) will not be reused.

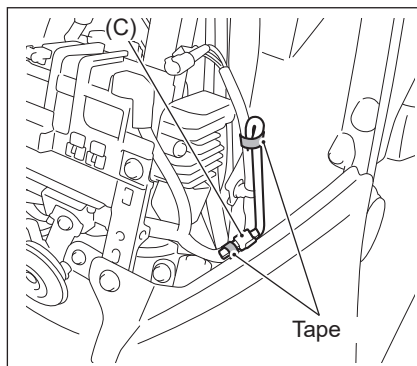

5. Connect the coupler of the USB Socket ① to the motorcycle harness.
6. Push the clamp assembled in the lead wire of the USB Socket ① to the rib of the leg shield deeply.

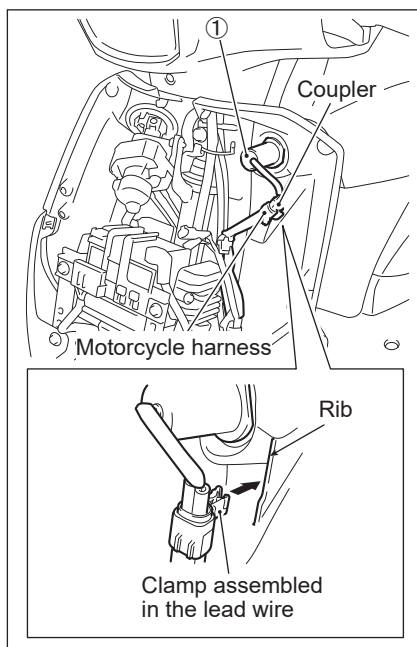

7. Install the removed motorcycle parts in the reverse order of removal.

**Handling
precautions**

- Don't use the USB Socket in the environment that water is thrown such as rain or washing.
- When washing motorcycle, don't throw water hard to the USB Socket, even if the cap is closed. If water comes into the USB Socket, it may cause damage.
- When the USB Socket isn't used, close the cap to prevent the foreign object from coming into it.
- Prevent the cable from being caught or entangled to avoid interfering the riding operation.
- Don't use the device which exceeds the rated values. It may cause battery drain or fuse blown.
[Rated values] 5V2A
- When engine is idling or stopping, using the USB Socket may drain the battery.
- When motorcycle is stopping, racing the engine for charging battery may cause motorcycle breakdown.
- Customer is responsible for the usage of the connected device.